Midsouth Home Inspections
1280 River Hollow Cove
Cordova, TN 38016
(901) 336-3551
midsouthhomeinspections.com
diley123@yahoo.com
Inspected By: Dan Iley



Home Inspection Report

Prepared For:

Unspecified Client

Property Address:

1950
Corning
Memphis, Tn 38127

Inspected on Fri, Aug 28 2026 at 10:15AM

Table of Contents

General	4
Site	4
Exterior	5
Roofing	7
Structure	8
Electrical	11
HVAC	12
Plumbing	14
Bathrooms	16
Kitchen	17
Laundry	20
Interior	21
Report Summary	26

Thank you for the opportunity to conduct a home inspection of the property listed above. We understand that the function of this report is to assist you in understanding the condition of the property to assist in making an informed purchase decision.

The report contains a review of components in the following basic categories: site, exterior, roofing, structure, electrical, HVAC, plumbing, and interior. Additional categories may or may not be included. The report is designed to be easy to read and comprehend however it is important to read the entire report to obtain a full understanding of the scope, limitations and exclusions of the inspection.

In addition to the checklist items of the report there are several comments which are meant to help you further understand certain conditions observed. These are easy to find by looking for their icons along the left side margin. Comments with the blue icon are primarily informational and comments with the orange icon are also displayed on the summary. Please read them all.

DEFINITION OF CONDITION TERMS
Satisfactory: At the time of inspection the component is functional without observed signs of a substantial defect.

Marginal: At the time of inspection the component is functioning but is estimated to be nearing end of useful life. Operational maintenance recommended. Replacement anticipated.

Repair or Replace: At the time of inspection the component does not function as intended or presents a Safety Hazard. Repair or replacement is recommended.

Further Evaluation: The component requires further technical or invasive evaluation by qualified professional tradesman or service technician to determine the nature of any potential defect, the corrective action and any associated cost.

General

Property Type:	Single Family
Stories:	One
Approximate Age:	69 Years Old
Age Based On:	shelby County Assessors website
Bedrooms/Baths:	3/1
Door Faces:	South
Furnished:	No
Occupied:	No
Weather:	Sunny
Temperature:	Hot
Soil Condition:	Dry
Utilities On During Inspection:	Electric Service, Gas Service, Water Service

Square Footage

Comment 1:
measured square footage 986 ft.²

Site

The condition of the vegetation, grading, surface drainage and retaining walls that are likely to adversely affect the building is inspected visually as well as adjacent walkways, patios and driveways.

Site Grading:	Mostly Level, Sloped Away From Structure Condition: Satisfactory
Vegetation:	Generally Maintained Condition: Satisfactory
Driveway:	Concrete Condition: Satisfactory
Walkways:	Concrete Condition: Satisfactory
Steps/Stoops:	Concrete Condition: Satisfactory

Exterior

The visible condition of exterior coverings, trim and entrances are inspected with respect to their effect on the condition of the building.

Exterior Covering:	Brick, Wood siding Condition: Satisfactory
Exterior Trim Material:	Wood Condition: Satisfactory
Windows:	Vinyl, Aluminum Condition: Satisfactory
Entry Doors:	Wood, Steel Condition: Satisfactory

Comment 2:
General pictures of exterior.



Figure 2-1



Figure 2-2

(Exterior continued)



Figure 2-3



Figure 2-4

Comment 3:
deep ruts need to be filled in front yard.



Figure 3-1

(Exterior continued)

Comment 4:
electrical outlet needs to be secured inside wall in carport area.

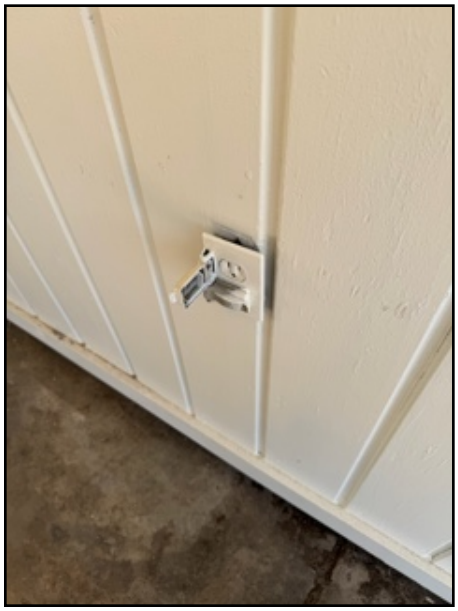


Figure 4-1

Roofing

The visible condition of the roof covering, flashings, skylights, chimneys and roof penetrations are inspected. The purpose of the inspection is to determine general condition, NOT to determine life expectancy.

Inspection Method:	Walked Roof/Arms Length
Roof Design:	Gable
Roof Covering:	architectural shingles
	Condition: Satisfactory
Approximate Roof Age:	less Than Three Years Old
Ventilation Present:	Gable Ends, Turbine
	Condition: Satisfactory
Soffit and Fascia:	Wood
	Condition: Satisfactory

Structure

The visible condition of the structural components is inspected. The determination of adequacy of structural components is beyond the scope of a home inspection.

Foundation Types:	Crawl Space
Foundation Material:	Concrete Block, brick
	Condition: Satisfactory
Signs of Water Penetration:	Moisture
	Condition: Satisfactory
Floor Structure:	Wood Frame
	Condition: Satisfactory
Subflooring:	Solid Wood Plank
	Condition: Satisfactory
Wall Structure:	Full Masonry
	Condition: Satisfactory

Comment 5:



Figure 5-1



Figure 5-2

(Structure continued)



Figure 5-3



Figure 5-4

Attic

Attic Entry:	Hallway
Roof Framing Type:	Joist and Rafters Condition: Satisfactory
Roof Deck Material:	Solid Wood Plank Condition: Satisfactory
Insulation:	Blown In Fiberglass, Blown In Cellulose Condition: Satisfactory

(Attic continued)

Comment 6:
Attic is in good condition.. Framing is sound and there is no evidence of leaks

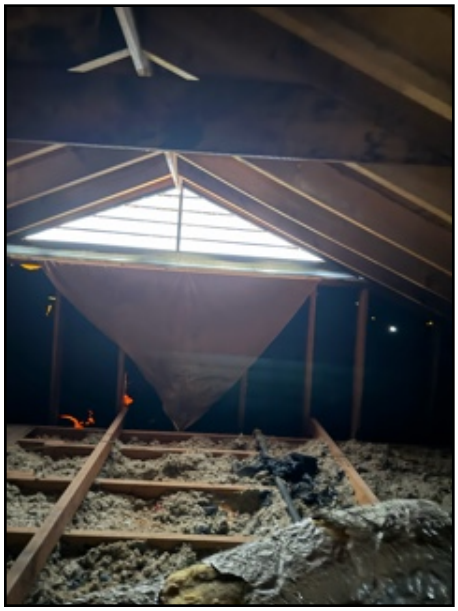


Figure 6-1



Figure 6-2



Figure 6-3

Electrical

The inspector can not inspect hidden wiring or verify if the number of outlets is per the National Electric Code. A representative number of outlets, switches and fixtures are tested for operation.

Type of Service:	Overhead
Main Disconnect Location:	Service Panel
Service Panel Location:	Interior
Service Voltage:	240 volts
Service Amperage:	200 amps
Service Panel Ground:	Ground Rod
Branch Circuit Wiring:	Non-Metallic Shielded Copper Condition: Satisfactory
Overcurrent Protection:	Breakers Condition: Satisfactory
GFCI/AFCI Breakers:	Yes Condition: Satisfactory
Smoke Detectors:	9 volt Battery Type Condition: Satisfactory

Comment 7:



Figure 7-1

(Electrical continued)

Comment 8:
carbon monoxide detector is installed.



Figure 8-1

HVAC

HVAC System Type: Central Split System

Heating

The heating system is inspected visually and operated by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of the heating system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

Location: Hallway
Type of Distribution: Metal Ducting
Condition: Further Evaluation Required

(Heating continued)

Comment 9:
no furnace installed at time of inspection.



Figure 9-1

Furnaces over 10 years old should be checked, cleaned and serviced yearly by a licensed contractor.

Cooling

The cooling system is inspected by operation of the equipment by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of cooling system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

Energy Source: Electric

(Cooling continued)

Comment 10:
no AC condenser installed at time of inspection.



Figure 10-1

Air conditioners over 10 years old and heat pumps over 5 years old should be checked, cleaned and serviced yearly by a licensed contractor.

Plumbing

The plumbing system is inspected visually and by operating a representative number of fixtures and drains. Private water and waste systems are beyond the scope of a home inspection.

Supply Pipe Material:	Copper Condition: Satisfactory
Location of Main Water Shutoff:	At Meter
Waste Pipe Material:	PVC, Cast Iron Condition: Satisfactory
Location of Fuel Shutoff:	At Meter

(Plumbing continued)

Water Heater

Manufacturer:	Rheem
Fuel:	Natural Gas
Capacity:	40 gal
Approximate Age:	New
Temp & Pressure Relief Valve:	Present With Blow Off Leg Condition: Satisfactory
Fuel Disconnect:	In Same Room

Comment 11:
Hot water temperature 120°.



Figure 11-1



Figure 11-2

(Water Heater continued)

Comment 12:
vent collar needed for vent pipe as noted by a picture.



Figure 12-1

Bathrooms

(Bathrooms continued)

Comment 13:



Figure 13-1

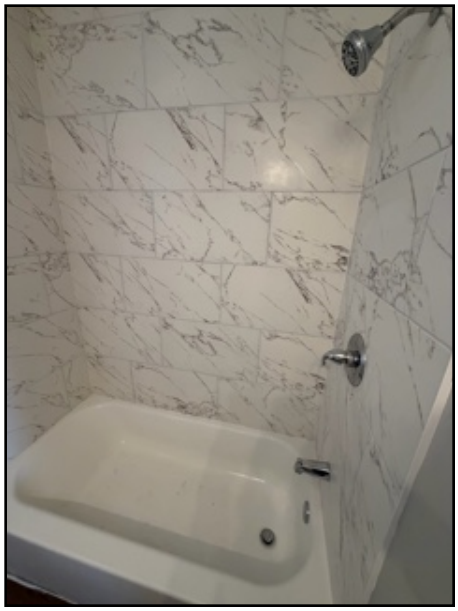


Figure 13-2

Kitchen

Cabinets:	Wood Condition: Satisfactory
Countertops:	Laminated Condition: Satisfactory
Sink:	Double Condition: Satisfactory

(Kitchen continued)

Comment 14:



Figure 14-1



Figure 14-2

Comment 15:
cabinet door will not stay shut in kitchen.

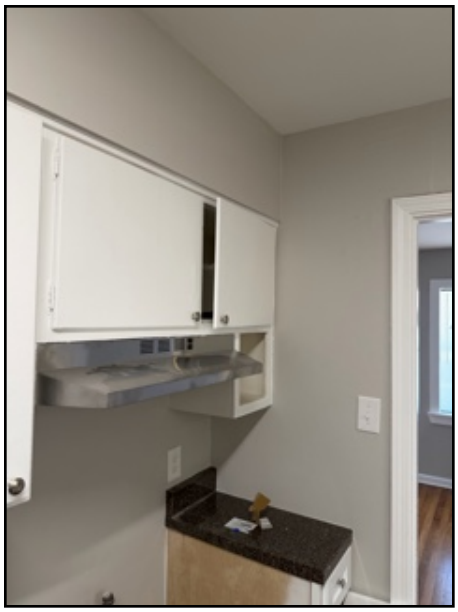


Figure 15-1

(Kitchen continued)

Comment 16:
electrical outlet needs to be installed for vent hood.



Figure 16-1

Comment 17:
cabinet door needs knob installed.



Figure 17-1

(Kitchen continued)

Comment 18:
no dishwasher installed.



Figure 18-1

Laundry

Dryer Venting:	To Exterior Condition: Satisfactory
Laundry Hook Ups:	Yes Condition: Satisfactory

(Laundry continued)

Comment 19:

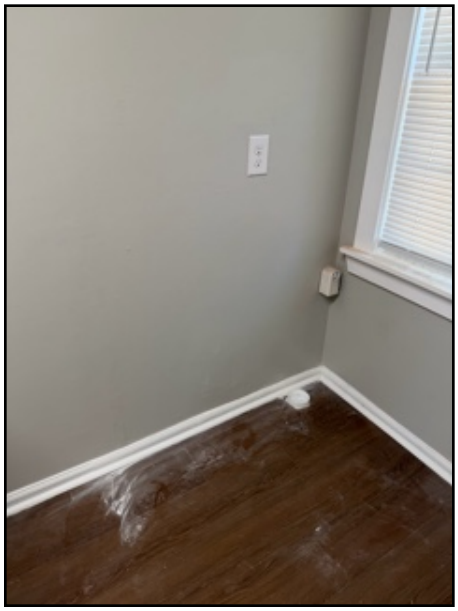


Figure 19-1

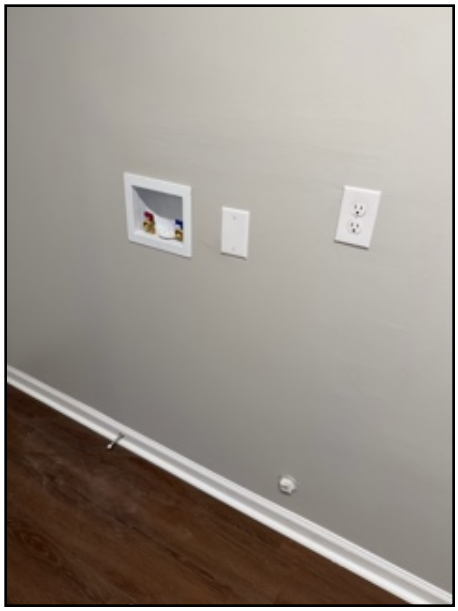


Figure 19-2

Interior

The interior inspection is limited to readily accessible areas that are not concealed by furnishings or stored items. A representative number of windows and doors.

Floors:	Wood, Vinyl Condition: Satisfactory
Walls:	Painted Drywall Condition: Satisfactory
Window Types:	Single Hung Condition: Satisfactory
Window Materials:	Aluminum , Vinyl
Entry Door Types:	Hinged Condition: Satisfactory
Entry Door Materials:	Wood, Steel
Interior Door Materials:	Wood

(Interior continued)

Comment 20:
General pictures of Living room, dining area, bedrooms and closets.



Figure 20-1



Figure 20-2

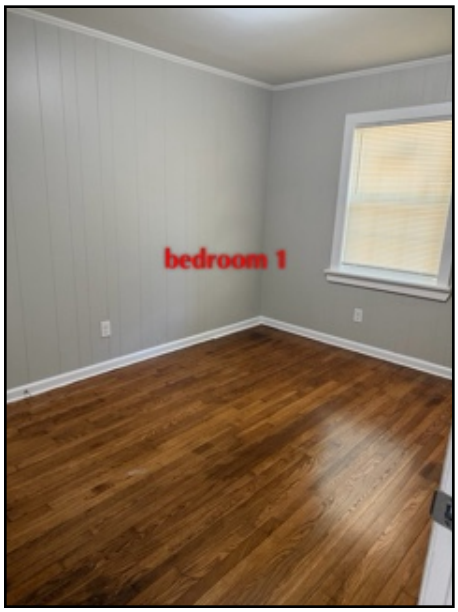


Figure 20-3

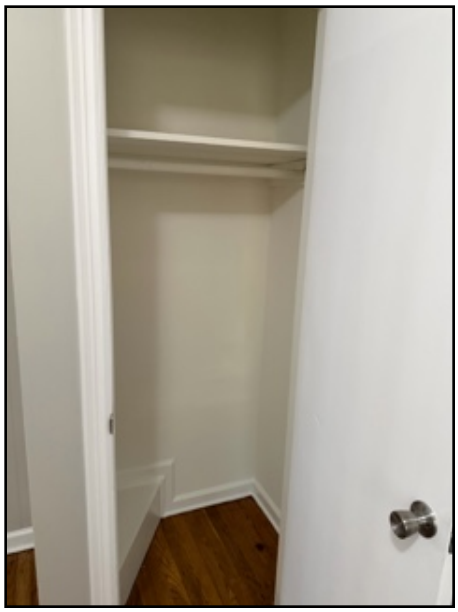


Figure 20-4

(Interior continued)



Figure 20-5



Figure 20-6

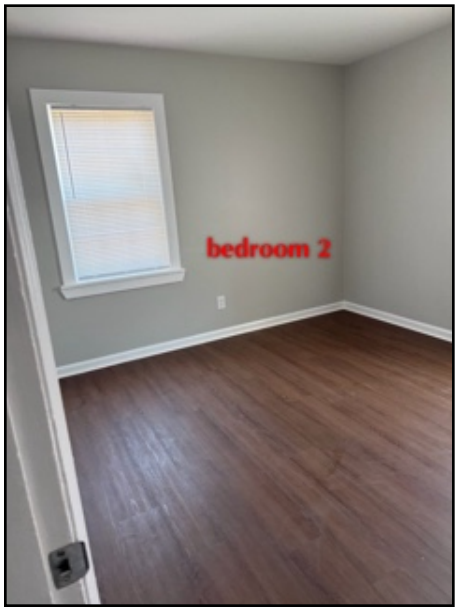


Figure 20-7



Figure 20-8

(Interior continued)

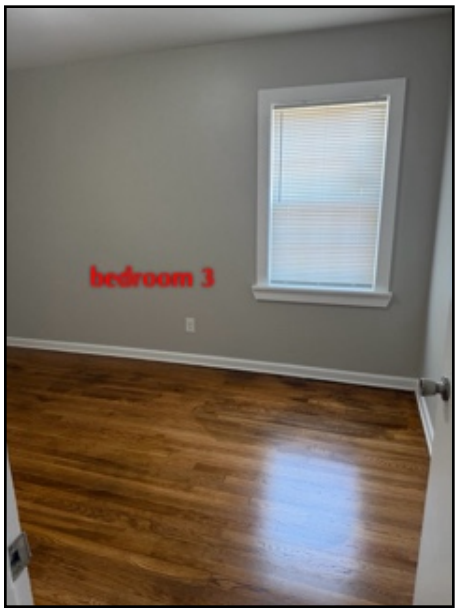


Figure 20-9



Figure 20-10



Figure 20-11

(Interior continued)

Comment 21:
Air gap noted around front security door.

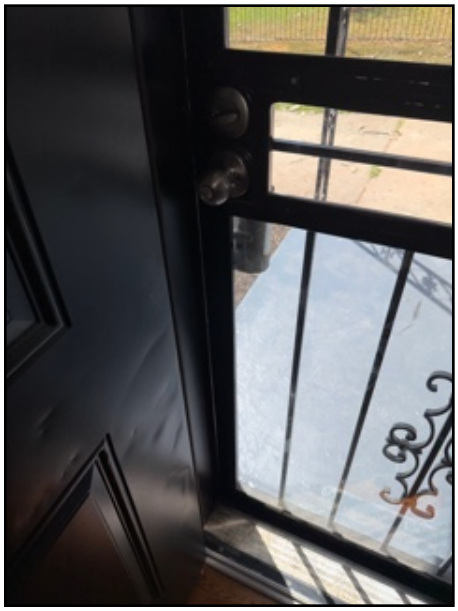


Figure 21-1

Report Summary

Exterior

1) deep ruts need to be filled in front yard.



Figure 3-1

2) electrical outlet needs to be secured inside wall in carport area.



Figure 4-1

(Report Summary continued)

HVAC: Heating

3) no furnace installed at time of inspection.



Figure 9-1

HVAC: Cooling

4) no AC condenser installed at time of inspection.



Figure 10-1

(Report Summary continued)

Plumbing: Water Heater

5) vent collar needed for vent pipe as noted by a picture.



Figure 12-1

Kitchen

6) cabinet door will not stay shut in kitchen.

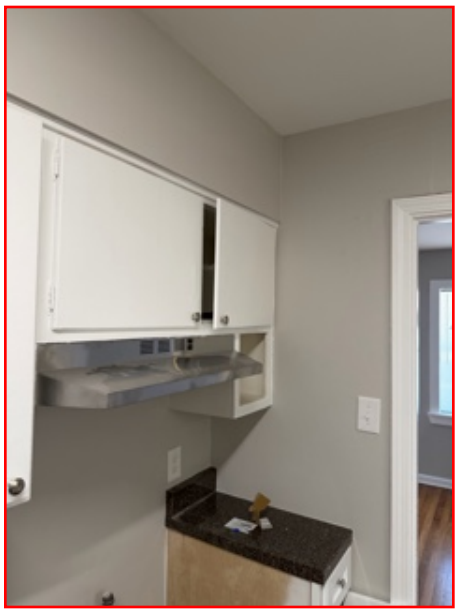


Figure 15-1

7) electrical outlet needs to be installed for vent hood.

(Report Summary continued)



Figure 16-1

8) cabinet door needs knob installed.



Figure 17-1

9) no dishwasher installed.

(Report Summary continued)



Figure 18-1

Interior

10) Air gap noted around front security door.

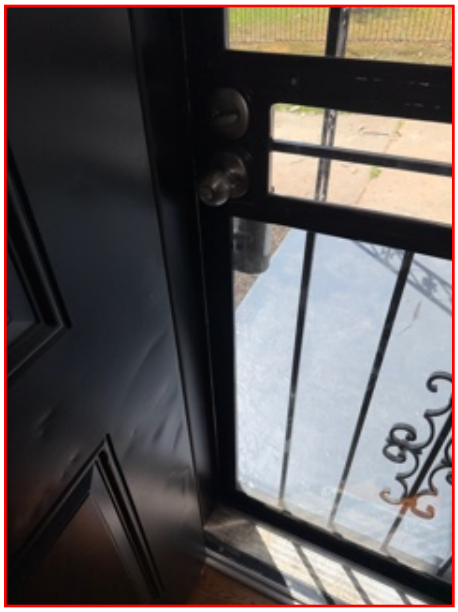


Figure 21-1